

# WEEKLY INCIDENT SUMMARY

Week ending Friday 15 April February 2022

This incident summary provides information on reportable incidents and safety advice for the NSW mining industry. To report an incident to the NSW Resources Regulator: phone 1300 814 609 24 hours a day, 7 days a week.

## At a glance

High level summary of emerging trends and our recommendations to operators.

TYPE	NUMBER
Reportable incident total	36
Summarised incident total	5

## Summarised incidents

INCIDENT TYPE	SUMMARY	COMMENTS TO INDUSTRY
Dangerous incident IncNot0041984 Open cut coal mine Roads or other vehicle operating areas	A dozer was pushing material in the north-west corner of the dump. A haul truck arrived and started to reverse into the north-east corner of the dump. The dozer operator started reversing across the dump to allow the truck to unload in the north-west corner. The truck and dozer collided. There was no communication between the truck and dozer.	Mine operators must have robust systems in place for supervisors to verify that identified controls such as positive communication are implemented, used correctly and are appropriate.  Workers have a legislative responsibility to follow procedures such as positive communications.



Dangerous incident  
IncNot0041985  
Underground coal  
mine

A roof bolting rig was being removed from a continuous miner. The rig was supported by a chain block attached to a roof bolt. When the last bolt was removed the rig swung, pinning a worker to the rib protection. The bolting rig was pushed off the worker, who then walked to the crib room. The worker was driven out of the mine and transferred to hospital. The worker suffered 2 broken ribs and a lacerated lung.

During tasks involving lifting, workers must assess the potential for the load to shift as it is moved. When the potential for load-shifting exists, controls such as no-go zones must be defined and communicated to all workers involved in the task.



Dangerous incident  
IncNot0041991  
Open cut coal mine  
Roads or other  
vehicle operating  
areas



A dozer was cleaning up material on the dig bench and repairing the floor. A dump truck arrived on the dig bench and parked on the low-wall side, waiting to be called to load. The dozer finished cleaning up and reversed 40 m to the low-wall side where the dump truck was parked. The dozer hit the off-side of the dump truck, damaging the fuel tank.

Vehicle collisions on mine sites continue to be a source of concern. As technology evolves and develops, mine operators should routinely review proximity detection and collision avoidance systems to determine if they are suitable for their operation. Workers should use all aids such as mirrors, cameras and awareness systems that are fitted when operating plant, particularly when reversing.



Dangerous incident  
IncNot0042002  
Open cut coal mine  
Ground or strata  
failure



A dozer was working on a clean coal stockpile when there was a slumping of coal into the valve. The dozer sunk about 2 m but remained level. The operator remained in the dozer while 2 other dozers cleared coal so the dozer could walk out of the slump.



Workers must be trained to operate dozers on reclaim stockpiles. This training must include identifying and responding to alarms and managing the hazards associated with draw down valves.

Additionally, workers must be familiar with different coal properties and how this impacts material behaviour on stockpiles.

Dangerous incident  
IncNot0042016  
Open cut coal mine  
Roads or other  
vehicle operating  
areas



A light vehicle was travelling along a haul road. The operator was distracted by an open lid on a toolbox and has driven up a windrow and rolled onto the roof. The driver exited the cab of the vehicle with no injuries.



Workers must always remain focused on controlling their vehicle. If a situation develops that requires their attention, such as an open toolbox, operators should safely stop the vehicle before addressing the issue.

## Other publications of interest

The incidents are included for your review. The NSW Resources Regulator does not endorse the findings or recommendations of these incidents. It is your legal duty to exercise due diligence to ensure the business complies with its work health and safety obligations.

PUBLICATION	ISSUE/TOPIC
	<b>National (other, non-fatal)</b>
<b>NZ MinEx</b>	Plant on plant interaction - a 36 t excavator was working adjacent to a haul road. When the water cart drove past, the excavator operator has swung on the blind side and the bucket of the excavator hit the cab of the water cart, displacing the roof of the vehicle cabin and damaging the windscreen. <a href="#">Details</a>

**Note:** While the majority of incidents are reported and recorded within a week of the event, some are notified outside this time period. The incidents in this report therefore have not necessarily occurred in a one-week period. All newly recorded incidents, whatever the incident date, are reviewed by the Chief Inspector and senior staff each week. For more comprehensive statistical data refer to our annual performance measures reports.

© State of New South Wales through Regional NSW 2022 You may copy, distribute, display, download and otherwise freely deal with this publication for any purpose, provided that you attribute Regional NSW as the owner. However, you must obtain permission if you wish to charge others for access to the publication (other than at cost); include the publication in advertising or a product for sale; modify the publication; or republish the publication on a website. You may freely link to the publication on a departmental website.

Disclaimer: The information contained in this publication is based on knowledge and understanding at the time of writing (April 2022) and may not be accurate, current or complete. The State of New South Wales (including Regional NSW), the author and the publisher take no responsibility, and will accept no liability, for the accuracy, currency, reliability or correctness of any information included in the document (including material provided by third parties). Readers should make their own inquiries and rely on their own advice when making decisions related to material contained in this publication.

DOCUMENT CONTROL	
<b>CM9 reference</b>	RDOC22/61004
<b>Mine safety reference</b>	ISR22-15
<b>Date published</b>	22 April 2022
<b>Approved by</b>	Deputy Chief Inspector Office of the Chief Inspector