

# Weekly incident summary

# Week ending 29 Sept 2023

This incident summary provides information on reportable incidents and safety advice for the NSW mining industry. To report an incident to the NSW Resources Regulator: phone 1300 814 609 24 hours a day, 7 days a week.

### At a glance

High level summary of emerging trends and our recommendations to operators.

Туре	Number
Reportable incident total	40
Summarised incident total	2

### Summarised incidents


Incident type	Summary	Comments to industry
Dangerous incident IncNot0045480 Underground metals	A structural failure in a mill resulted in a zinc rougher launder detaching from the rougher and landing on a concrete mezzanine floor below. The floor then catastrophically failed, cantilevered over, and came to rest on infrastructure in the basement under the cell.  No one was in the vicinity at the time.	Mine operators should ensure that excessive build-up of solidified concentrate is managed to ensure structural overloading does not occur.  Spillage of concentrates should also be managed to avoid degradation and corrosion of structures.  Mine operators must ensure that appropriate risk-managed structural assessments are undertaken at regular intervals and remedial measures are implemented where damage to load bearing structures are identified.

## Weekly incident summary week ending 29 Sept 2023

#### Incident type

#### Summary

#### Comments to industry

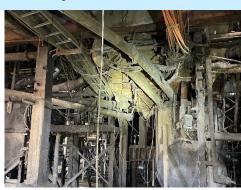

Dangerous incident
IncNot0045496
Open cut coal
Roads or other vehicle



operating areas

A dozer operator was pushing carbonaceous matter close to the bottom of a pit. The pit was full of water. The dozer went too far down the slope towards the body of water and couldn't get back up. The operator tried to turn the dozer but was unsuccessful.



Mine operators should review and update their dozer bulk push risk assessment and associated procedures to include the requirement to clearly define the dozer bulk push area to prevent dozers from working in areas of risk.

Workers should be provided adequate information, training, and instruction regarding updates to bulk push designated zones and the requirement to remain inside the zone.

Note: While the majority of incidents are reported and recorded within a week of the event, some are notified outside this time period. The incidents in this report therefore have not necessarily occurred in a one-week period. All newly recorded incidents, whatever the incident date, are reviewed by the Chief Inspector and senior staff each week. For more comprehensive statistical data refer to our annual performance measures reports.

© State of New South Wales through Regional NSW 2023. You may copy, distribute, display, download and otherwise freely deal with this publication for any purpose, provided that you attribute Regional NSW as the owner. However, you must obtain permission if you wish to charge others for access to the publication (other than at cost); include the publication in advertising or a product for sale; modify the publication; or republish the publication on a website. You may freely link to the publication on a departmental website.

Disclaimer: The information contained in this publication is based on knowledge and understanding at the time of writing (October 2023) and may not be accurate, current or complete. The State of New South Wales (including Regional NSW), the author and the publisher take no responsibility, and will accept no liability, for the accuracy, currency, reliability or correctness of any information included in the document (including material provided by third parties). Readers should make their own inquiries and rely on their own advice when making decisions related to material contained in this publication.

Document control	
CM9 reference	DOC23/281437
Mine safety reference	ISR23-38
Date published	6 October 2023

# Weekly incident summary week ending 29 Sept 2023

Document control	
Authorised by	Director Regulatory Operations Mine Safety Office of the Chief Inspector